PRINTED: 11/24/2015 FORM APPROVED

(X3) DATE SURVEY

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES

(X1) PROVIDER/SUPPLIER/CLIA

AND PLAN OF CORRECTION **IDENTIFICATION NUMBER:** COMPLETED A. BUILDING: 01 R B. WING HAL045001 10/29/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 1000 WEST ALLEN STREET **CARDINAL CARE CENTER-HENDERSONVILLE** HENDERSONVILLE, NC 28739 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (X5) COMPLETE (EACH DEFICIENCY MUST BE PRECEDED BY FULL (EACH CORRECTIVE ACTION SHOULD BE PRÉFIX **PREFIX** DATE REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG TAG DEFICIENCY) {C 000} Initial Comments {C 000} Report of Follow-up Survey by Dennis Harrell on 10-29-2015. Some deficiencies were not corrected. Further action is required. {C 101} Existing Licensed Fac- No less than '71 Rules {C 101} SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0301 APPLICATION OF PHYSICAL PLANT REQUIREMENTS The physical plant requirements for each adult care home shall be applied as follows: (2) Except where otherwise specified, existing licensed facilities or portions of existing licensed facilities shall meet licensure and code requirements in effect at the time of construction. change in service or bed count, addition, renovation, or alteration; however in no case shall the requirements for any licensed facility where no addition or renovation has been made, be less than those requirements found in the 1971 "Minimum and Desired Standards and Regulations" for "Homes for the Aged and Infirm", copies of which are available at the Division of Health Service Regulation at no cost; This Rule is not met as evidenced by: 1- Based on observations, the facility failed to ensure that the building meets the NC State Building Code regarding emergency exiting. This deficiency directly affects all residents, personnel, and visitors who may have to exit the facility in an emergency. Findings on include: a- The emergency release buttons for the

(X2) MULTIPLE CONSTRUCTION

Division of Health Service Regulation

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE (X6) DATE

PRINTED: 11/24/2015 FORM APPROVED

Division of Health Service Regulation

(X1) PROVIDER/SUPPLIER/CLIA STATEMENT OF DEFICIENCIES (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION **IDENTIFICATION NUMBER:** COMPLETED A. BUILDING: 01 R B. WING _ HAL045001 10/29/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE **1000 WEST ALLEN STREET CARDINAL CARE CENTER-HENDERSONVILLE** HENDERSONVILLE, NC 28739 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (X5) COMPLETE (EACH DEFICIENCY MUST BE PRECEDED BY FULL (EACH CORRECTIVE ACTION SHOULD BE PRÉFIX **PREFIX** DATE REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG TAG DEFICIENCY) {C 101} Continued From page 1 {C 101} magnetic locks located at all EXITs are momentary release buttons, allowing the doors to re-lock after approximately 30 seconds. {C 154} Entrances/Exits-Wanderer Alarms {C 154} SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0305 PHYSICAL **ENVIRONMENT** (h) The requirements for outside entrances and exits are: (4) In homes with at least one resident who is determined by a physician or is otherwise known to be disoriented or a wanderer, each exit door accessible by residents shall be equipped with a sounding device that is activated when the door is opened. The sound shall be of sufficient volume that it can be heard by staff. If a central system of remote sounding devices is provided, the control panel for the system shall be located in the office of the administrator or in a location accessible only to staff authorized by the administrator to operate the control panel. This Rule is not met as evidenced by: 1- Based on observations and interviews with the staff, the facility has failed to have a system for monitoring all exit doors in accordance with this Rule. This may affect any disoriented resident if not supervised. Findings include: a- The two exit doors from the back and middle corridors lead into the secure courtyard and are kept unlocked at all times and are equipped with no sounding devices. There was no method identified to prevent residents who may be disoriented from going outside into the courtyard during times of extreme temperatures or weather.

Division of Health Service Regulation

PRINTED: 11/24/2015 FORM APPROVED

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01		(X3) DATE SURVEY COMPLETED	
		HAL045001	B. WING		R 10/29/2015	
NAME OF PROVIDER OR SUPPLIER CARDINAL CARE CENTER-HENDERSONVILLE 1000 WEST ALLEN STREET HENDERSONVILLE, NC 28739						
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD CROSS-REFERENCED TO THE APPROVIDENCY)	ON SHOULD BE COMPLETE DATE	
{C 189}	SECTION .0300 - F 10A NCAC 13F .03 REQUIREMENTS (a) The building an mechanical, and plucare home shall be operating condition (k) This Rule shall facilities with the exwhich shall not app This Rule is not medure that the built the fire resistance of deficiency directly and visitors by allows moke beyond the Findings on include a- There are unprofollowing locations 5- The Mechan (foam)	and all fire safety, electrical, sumbing equipment in an adult maintained in a safe and apply to new and existing acception of Paragraph (e) ly to existing facilities. Let as evidenced by: Let as e	{C 189}			

Division of Health Service Regulation STATE FORM